

WKO // with integrated transmitter and plug connector // -50...150°C



WKO

Your advantages

Type	WKO
	<ul style="list-style-type: none"> • Designed for use in harsh environments on construction and extraction machines • The transmitter integrated in the housing provides a fail-safe and standardized output signal • Safe electrical connection due to robust DEUTSCH connector system • Very high vibration and shock resistance → Reliable and long-lasting operation • High protection class against moisture, dust and dirt ingress • Extremely resistant connecting cable → Enables use in harsh environments

Technical data	
Type	Temperature sensor with integrated transmitter and plug connector
Measuring range	-50...150 °C
Measuring medium	Water and aqueous liquids, non-aggressive gases
Immersion tube length	30...100 mm
Immersion tube diameter	7 mm
Process connection	G½
Nominal pressure	PN 25
Medium temperature	-50...150 °C
Ambient temperature	-40...85 °C
Storage temperature	-25...70 °C
Degree of protection according to EN 60529	IP65

Electrical data	
Measuring element	1 x Pt100 / 2-wire
Measuring insert	Not interchangeable
Accuracy	Class B / ±(0.30 K + 0.005 x t)
Electrical connection	FEP cable, wire braided, with mounted DEUTSCH plug or KENPUR 500, orange, with mounted DEUTSCH plug
Supply voltage	→ 4...20 mA → 0...10 V
	10...35 VDC 15...30 VDC
Analogue output	
Current signal	4...20 mA or 0...10 V
Scaling	Programmable

Архангельск (8182)63-90-72
Астана (7172)727-132
Астрахань (8512)99-46-04
Барнаул (3852)73-04-60
Белгород (4722)40-23-64
Брянск (4832)59-03-52
Владивосток (423)249-28-31
Волгоград (844)278-03-48
Вологда (8172)26-41-59
Воронеж (473)204-51-73
Екатеринбург (343)384-55-89
Иваново (4932)77-34-06

Ижевск (3412)26-03-58
Иркутск (395)279-98-46
Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Липецк (4742)52-20-81
Киргизия (996)312-96-26-47


Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Нижний Новгород (831)429-08-12
Новокузнецк (3843)20-46-81
Новосибирск (383)227-86-73
Омск (3812)21-46-40
Краснодар (861)203-40-90
Орел (4862)44-53-42
Оренбург (3532)37-68-04
Пенза (8412)22-31-16
Казахстан (772)734-952-31

Пермь (342)205-81-47
Ростов-на-Дону (863)308-18-15
Рязань (4912)46-61-64
Самара (846)206-03-16
Санкт-Петербург (812)309-46-40
Саратов (845)249-38-78
Севастополь (8692)22-31-93
Симферополь (3652)67-13-56
Смоленск (4812)29-41-54
Сочи (862)225-72-31
Ставрополь (8652)20-65-13
Таджикистан (992)427-82-92-69

Сургут (3462)77-98-35
Тверь (4822)63-31-35
Томск (3822)98-41-53
Тула (4872)74-02-29
Тюмень (3452)66-21-18
Ульяновск (8422)24-23-59
Уфа (347)229-48-12
Хабаровск (4212)92-98-04
Челябинск (351)202-03-61
Череповец (8202)49-02-64
Ярославль (4852)69-52-93

<https://sika.nt-rt.ru/> || skx@nt-rt.ru

WKO

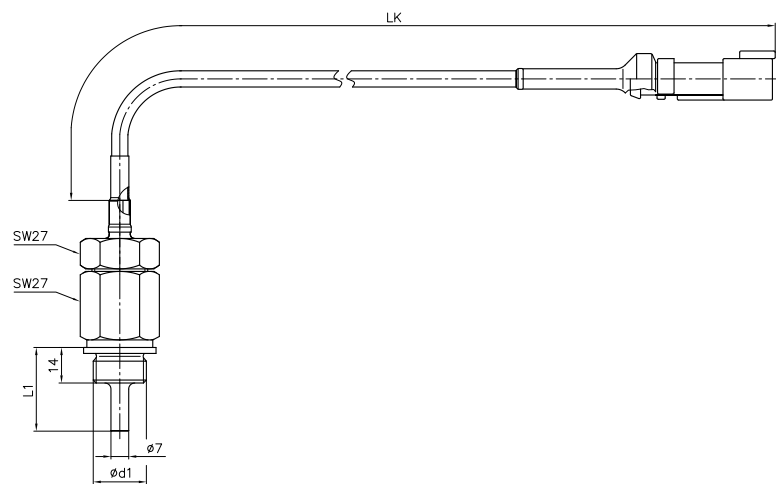

Materials

In contact with media

Process connection

Protection tube

Brass 2.0401 or Stainless steel 1.4571

Brass 2.0401 or Stainless steel 1.4571

Order code									
Type									
Resistance thermometer		W							
Diameter									
7 mm		07							
Material									
Brass 2.0401			1						
Stainless steel 1.4571			3						
Sensor element									
1 x Pt100 2-wire / Class B				P21					
Nominal length L1									
30 mm					030				
100 mm					100				
Electrical connection									
FEP cable, wire braided						27			
KENPUR 500, orange						xx			
Process connection d1									
G½							2		
Cable length LK									
1.0 m								01	
1.5 m								02	
2.0 m								03	
2.5 m								04	
Signal output									
4...20 mA, 2-wire									I
0...10 V, 3-wire									U
Example order number		W	07	1	P21	030	27	2	01
									I

Архангельск (8182)63-90-72
 Астана (7172)727-132
 Астрахань (8512)99-46-04
 Барнаул (3852)73-04-60
 Белгород (4722)40-23-64
 Брянск (4832)59-03-52
 Владивосток (423)249-28-31
 Волгоград (844)278-03-48
 Вологда (8172)26-41-59
 Воронеж (473)204-51-73
 Екатеринбург (343)384-55-89
 Иваново (4932)77-34-06

Ижевск (3412)26-03-58
 Иркутск (395)279-98-46
 Казань (843)206-01-48
 Калининград (4012)72-03-81
 Калуга (4842)92-23-67
 Кемерово (3842)65-04-62
 Киров (8332)68-02-04
 Краснодар (861)203-40-90
 Красноярск (391)204-63-61
 Курск (4712)77-13-04
 Липецк (4742)52-20-81
 Киргизия (996)312-96-26-47

Магнитогорск (3519)55-03-13
 Москва (495)268-04-70
 Мурманск (8152)59-64-93
 Набережные Челны (8552)20-53-41
 Нижний Новгород (831)429-08-12
 Новокузнецк (3843)20-46-81
 Новосибирск (383)227-86-73
 Омск (3812)21-46-40
 Орел (4862)44-53-42
 Оренбург (3532)37-68-04
 Пенза (8412)22-31-16
 Казахстан (772)734-952-31

Пермь (342)205-81-47
 Ростов-на-Дону (863)308-18-15
 Рязань (4912)46-61-64
 Самара (846)206-03-16
 Санкт-Петербург (812)309-46-40
 Саратов (845)249-38-78
 Севастополь (8692)22-31-93
 Симферополь (3652)67-13-56
 Смоленск (4812)29-41-54
 Сочи (862)225-72-31
 Ставрополь (8652)20-65-13
 Таджикистан (992)427-82-92-69

Сургут (3462)77-98-35
 Тверь (4822)63-31-35
 Томск (3822)98-41-53
 Тула (4872)74-02-29
 Тюмень (3452)66-21-18
 Ульяновск (8422)24-23-59
 Уфа (347)229-48-12
 Хабаровск (4212)92-98-04
 Челябинск (351)202-03-61
 Череповец (8202)49-02-64
 Ярославль (4852)69-52-93

<https://sika.nt-rt.ru/> || skx@nt-rt.ru